Operating Instructions









Bluestreak Equipment 1645 Hwy #3, Delhi Ontario, Canada N4B2W6



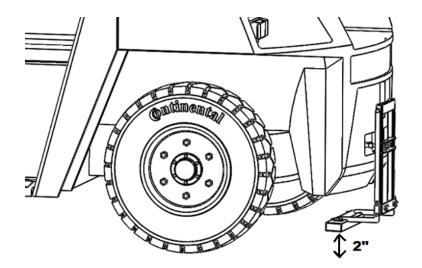




2. Stop the Forklift and remove the 2 wingnuts on the back of the Naos Sweeper.

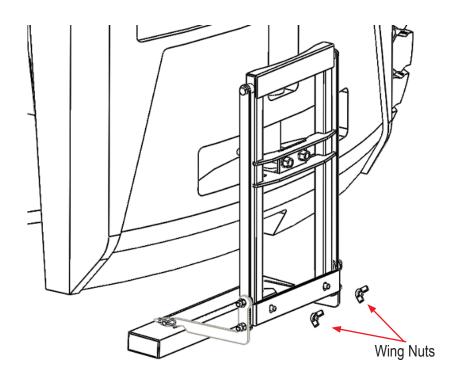




3. Swing magnet outwards and up and Clean Metal Debris off bottom (with Glove or Rag).

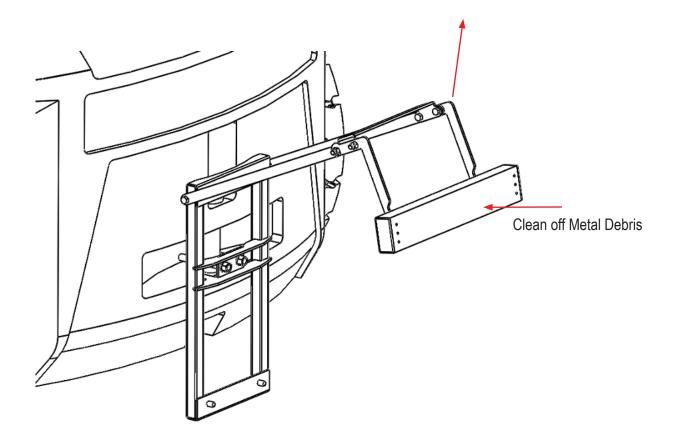



4. Swing Magnet downwards and re-install Wing Nuts firmly.

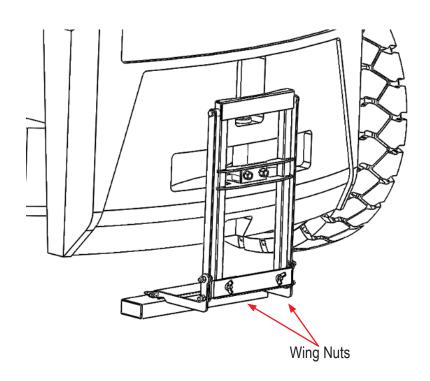





5. Continue driving around to collect additional metal debris.

